NUTRUNNER SWING CLAMPS

R⊕∺S IMAO




Body / Clamp-Arm Holder / Hex. Head	Clamp Arm
SCM440 steel	S45C steel
Quenched and tempered	Quenched and tempered
Black oxide finish	Black oxide finish

Without Clamp Arm Counterclockwise Clamping Clockwise Clamping 66 55 2 M12×1.75 31(Clamp-Arm Travel) 50 19 31 164 10(Clamping Stroke) 105 φ 26% 50 **Locating Boss**

Feature

The inside spiral groove allows the clamp arm to swing positively.



■With Clamp Arm

Part Number	Clamping Force (kN)	Allowable Tightening Torque (N·m) *)	Clamping Direction	Weight (kg)
PTSW2-12R	6	28	CW	2
PTSW2-12L			CCW	

■Without Clamp Arm


Part Number	Clamping Force (kN)	Allowable Tightening Torque (N·m)*)	Clamping Direction	Weight (kg)				
PTSW2-12NR	6	28	CW	1.6				
PTSW2-12NL			CCW					




Note: The clamp arm can be replaced with a custom one of your own design. Refer to the instruction on our website for the dimensions and details. Note that the clamping force with the custom clamp arm may increase or decrease from the values above.

*) If this product is operated with a nut runner and the nut is turned to the stop on the unclamping side, the tightening torque should be 50% or less of the allowable tightening torque.


How To Use



1. Unclamping Load a workpiece.

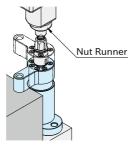

2. Travelling
Turn the hex. head with the
nut runner and the clamp
arm swings to the clamping
position.



3. Clamping
The clamp arm moves down
vertically for clamping.
Secure clamping can be
done in a few seconds with
the nut runner.



This clamp can be operated with an impact wrench. Use an impact wrench that can set the torque, as the clamp may be damaged if it is used with the tightening torque exceeding the allowable value for a long period of time.